



True RMS Industrial Digital Multimeter

AMM-1139 User's Manual




Contents

	Page
1.Introduction	4
2.Safety.....	4
3.Safety Instructions.....	5
4.Controls and Jacks.....	6
5.Symbols and Annunciators.....	6
6.Operating Instructions.....	7
6-1.DC Voltage Measurements.....	7
6-2.AC Voltage (Frequency, Duty Cycle) Measurements.....	8
6-3.mV Voltage Measurements.....	9
6-4.DC Current Measurements.....	10
6-5.AC Current (Frequency, Duty Cycle) Measurements.....	11
6-6.Resistance Measurements.....	12
6-7.Continuity Check.....	13
6-8.Diode Test.....	14
6-9.Capacitance Measurements.....	15
6-10.Temperature Measurements.....	16
6-11.Frequency (Duty Cycle) Measurements (Electronic)	17
6-13.Autoranging/Manual Range Selection.....	17
6-14.MAX/MIN.....	18
6-15.Relative Mode.....	18
6-16.Display Backlight.....	18
6-17.HOLD.....	18
6-18.PEAK HOLD.....	18
6-19.Data Record (Store/Recall).....	19
6-20.Wireless Data Sending Function.....	19
6-21.Parameter Setting Up(SET).....	20
6-22.AC+DC.....	21
6-23.Low Battery Indication.....	21
7.Maintenance.....	21
7-1.Battery Installation.....	22
7-2.Replacing The Fuses.....	23
8.Specifications.....	24
9.General Specifications.....	26

1. Introduction


This meter measures AC/DC Voltage, AC/DC Current, Resistance, Capacitance, Frequency (electrical & electronic), Duty Cycle, Diode Test, and Continuity plus Thermocouple Temperature. It can store and recall data. It features a waterproof, rugged design for heavy duty use. This meter can send out data wirelessly and be linked to PC. Proper use and care of this meter will provide many years of reliable service.


2. Safety


 This symbol adjacent to another symbol, terminal or operating device indicates that the operator must refer to an explanation in the Operating Instructions to avoid personal injury or damage to the meter.

WARNING This WARNING symbol indicates a potentially hazardous situation, which if not avoided, could result in death or serious injury.

CAUTION This CAUTION symbol indicates a potentially hazardous situation, which if not avoided, may result damage to the product.

 This symbol advises the user that the terminal(s) so marked must not be connected to a circuit point at which the voltage with respect to earth ground exceeds (in this case) 1000 VAC or VDC.

 This symbol adjacent to one or more terminals identifies them as being associated with ranges that may, in normal use, be subjected to particularly hazardous voltages. For maximum safety, the meter and its test leads should not be handled when these terminals are energized.

 This symbol indicates that a device is protected throughout by double insulation or reinforced insulation.

Per IEC1010 Overvoltage Installation Category

Overvoltage Category I

Equipment of Overvoltage Category I is equipment for connection to circuits in which measures are taken to limit the transient overvoltages to an appropriate low level.

Note – Examples include protected electronic circuits.

Overvoltage Category II

Equipment of Overvoltage Category II is energy-consuming equipment to be supplied from the fixed installation.

Note – Examples include household, office, and laboratory appliances.

Overvoltage Category III

Equipment of Overvoltage Category III is equipment in fixed installations.

Note – Examples include switches in the fixed installation and some equipment for industrial use with permanent connection to the fixed installation.

Overvoltage Category IV

Equipment of Overvoltage Category IV is for use at the origin of the installation.

Note – Examples include electricity meters and primary over-current protection equipment.

3.Safety Instructions

This meter has been designed for safe use, but must be operated with caution. The rules listed below must be carefully followed for safe operation.


• **NEVER** apply voltage or current to the meter that exceeds the specified maximum:

Input Protection Limits	
Function	Maximum Input
VDC or VAC	1000VDC/AC rms
mA AC/DC	500mA 1000V fast acting fuse
A AC/DC	10A 1000V fast acting fuse (20A for 30 seconds max every 15 minutes)
Frequency, Resistance, Capacitance,	1000VDC/AC rms
Duty Cycle, Diode Test, Continuity	1000VDC/AC rms
Temperature	
Surge Protection: 8kV peak per IEC 61010	

- **USE EXTREME CAUTION** when working with high voltages.
- **DO NOT** measure voltage if the voltage on the “**COM**” input jack exceeds 1000V above earth ground.
- **NEVER** connect the meter leads across a voltage source while the function switch is in the current, resistance, or diode mode. Doing so can damage the meter.
- **ALWAYS** discharge filter capacitors in power supplies and disconnect the power when making resistance or diode tests.
- **ALWAYS** turn off the power and disconnect the test leads before opening the covers to replace the fuse or batteries.
- **NEVER** operate the meter unless the back cover and the battery and fuse covers are in place and fastened securely.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

4.Controls and Jacks

- 1-40,000 count LCD display
- 2-STORE(◀ RECALL) button
- 3-MAX/MIN (-)button
- 4-MODE button
- 5-RANGE(SETUP) button
- 6-Function switch
- 7-10A input jack
- 8-mA, μ A input jack
- 9-COM input jack
- 10-Positive input jack
- 11-EXIT(AC+DC) button
- 12-Backlight(Ψ USB) button
- 13-HOLD(PEAKHOLD ▶) button
- 14-REL(+) button

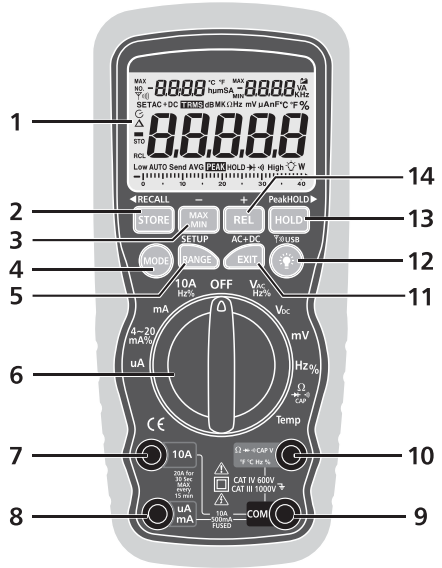

Note: Tilt stand and battery compartment are on rear of unit.

5.Symbols and Annunciators

\rightarrow	Continuity
\rightarrow	Diode test
BAT	Battery status
n	nano (10^{-9}) (capacitance)
μ	micro (10^{-6}) (amps, cap)
m	milli (10^{-3}) (volts, amps)
A	Amps
K	kilo (10^3) (ohms)
F	Farads (capacitance)
M	mega (10^6) (ohms)
Ω	Ohms
PEAK	Peak Hold
Hz	Hertz (frequency)
V	Volts
%	Percent (duty ratio)
Δ	Relative
AC	Alternating current
AUTO	Autoranging
DC	Direct current
HOLD	Display hold



°F	Degrees Fahrenheit
°C	Degrees Centigrade
MAX	Maximum
MIN	Minimum
NO.	Serial number
S	second
SET	Set up parameter
AC+DC	Alternating current + Direct current
TRMS	True RMS
STO	Store
RCL	Recall
⌚	Timing symbol
⚡	Backlight

6. Operating Instructions


WARNING: Risk of electrocution. High-voltage circuits, both AC and DC, are very dangerous and should be measured with great care.

- Always turn the function switch to the OFF position when the meter is not in use.
- If "OL" appears in the display during a measurement, the value exceeds the range you have selected. Change to a higher range.

6-1. DC Voltage Measurements

CAUTION: Do not measure DC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.

- Set the function switch to the "V_{DC}" position.
- Insert the black test lead banana plug into the "COM" jack. Insert the red test lead banana plug into the " Ω / \rightarrow / \rightarrow / \rightarrow /CAP/V^oF^oC/Hz%" jack.
- Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
- Read the voltage in the display.

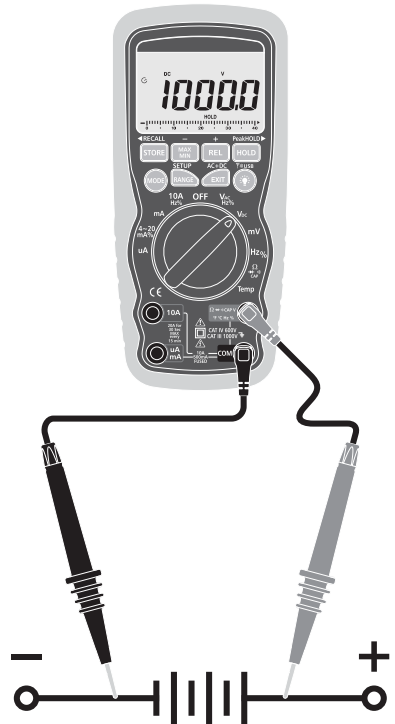


6-2.AC Voltage (Frequency, Duty Cycle) Measurements

WARNING: Risk of Electrocution. The probe tips may not be long enough to contact the live parts inside some 240V outlets for appliances because the contacts are recessed deep in the outlets. As a result, the reading may show 0 volts when the outlet actually has voltage on it. Make sure the probe tips are touching the metal contacts inside the outlet before assuming that no voltage is present.

CAUTION: Do not measure AC voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


- Set the function switch to the “V_{AC}/Hz/%” position.
- Insert the black test lead banana plug into the “COM” jack.
Insert red test lead banana plug into the “Ω/→/~/CAP/V/°F/°C/Hz%” jack.
- Touch the black test probe tip to the neutral side of the circuit.
Touch the red test probe tip to the “hot” side of the circuit.
- Read the voltage in the main display and the frequency in the right auxiliary display.
- Press the “MODE” button to indicate “Hz”.
- Read the frequency in the main display.
- Press the “MODE” button again to indicate “%”.
- Read the % of duty cycle in the main display.
- Press “EXIT” for 2 seconds into the function of AC+DC. Test DC and AC TURE Rms.

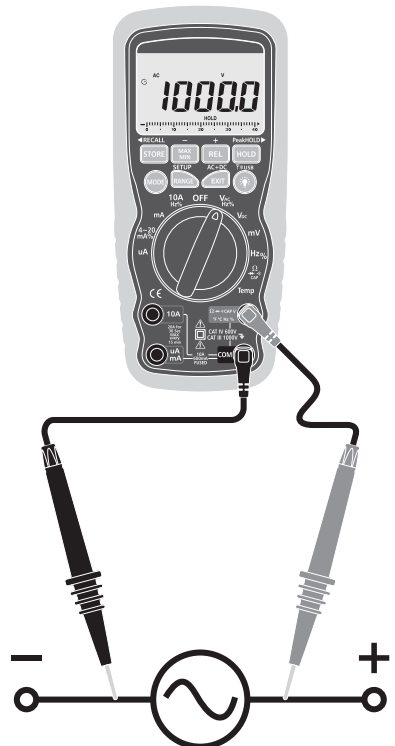

6-3.mV Voltage Measurements

CAUTION: Do not measure mV voltages if a motor on the circuit is being switched ON or OFF. Large voltage surges may occur that can damage the meter.


- Set the function switch to the “mV” position.
- Press the “MODE” button to indicate “DC” or “AC”, or in AC range press “EXIT” for two seconds and chose “AC+DC”
- Insert the black test lead banana plug into the “COM” jack.
Insert the red test lead banana plug into the “ $\Omega/\rightarrow/\rightarrow/\rightarrow$ /CAP/V^oF^oC/Hz%” jack.
- Touch the black test probe tip to the negative side of the circuit.
Touch the red test probe tip to the positive side of the circuit.
- Read the mV voltage in the main display.

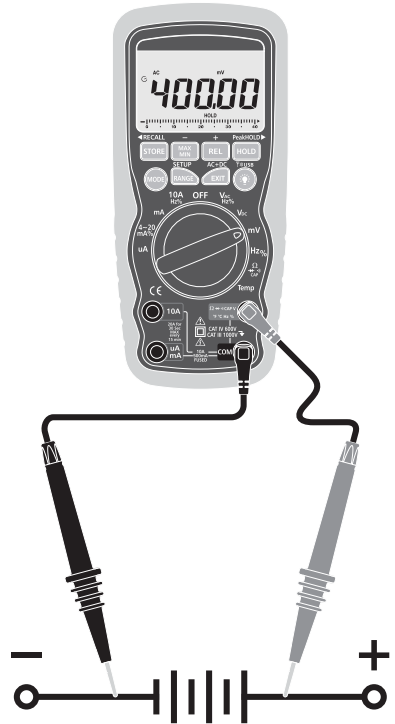

6-4.DC Current Measurements

CAUTION: Do not make 10A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


- Insert the black test lead banana plug into the "COM" jack.
- For current measurements up to $4000\mu\text{A}$ DC, set the function switch to the " μA " position and insert the red test lead banana plug into the " $\mu\text{A}/\text{mA}$ " jack.
- For current measurements up to 400mA DC, set the function switch to the " mA " position and insert the red test lead banana plug into the " $\mu\text{A}/\text{mA}$ " jack.
- For current measurements up to 10A DC, set the function switch to the " $10\text{A}/\text{HZ}/\%$ " position and insert the red test lead banana plug into the " 10A " jack.
- Press the "MODE" button to indicate "DC" on the display.
- Remove power from the circuit under test, then open up the circuit at the point where you wish to measure current.
- Touch the black test probe tip to the negative side of the circuit. Touch the red test probe tip to the positive side of the circuit.
- Apply power to the circuit.
- Read the current in the display.

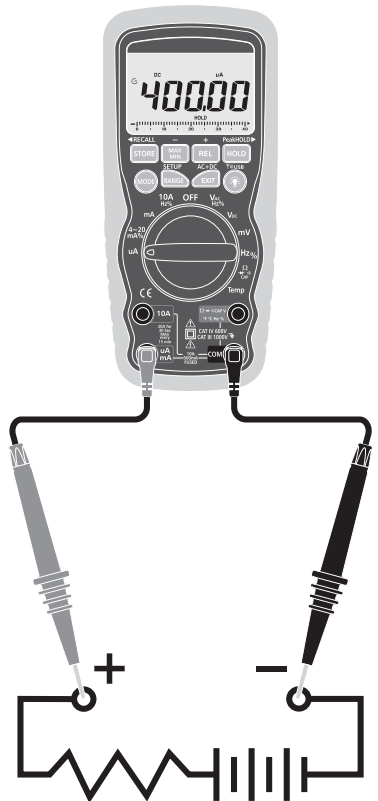

6-5.AC Current (Frequency, Duty Cycle) Measurements

CAUTION: Do not make 10A current measurements for longer than 30 seconds. Exceeding 30 seconds may cause damage to the meter and/or the test leads.


- Insert the black test lead banana plug into the “COM” jack.
- For current measurements up to $4000\mu\text{A}$ AC, set the function switch to the “ μA ” position and insert the red test lead banana plug into the “ $\mu\text{A}/\text{mA}$ ” jack.
- For current measurements up to 400mA AC, set the function switch to the “mA” position and insert the red test lead banana plug into the “ $\mu\text{A}/\text{mA}$ ” jack.
- For current measurements up to 10A AC, set the function switch to the “10A/HZ/%” position and insert the red test lead banana plug into the “10A” jack.
- Press the “MODE” button to indicate “AC” on the display.
- Remove power from the circuit under test, then open up the circuit at the point where you wish to measure current.
- Touch the black test probe tip to the neutral side of the circuit. Touch the red test probe tip to the “hot” side of the circuit.
- Apply power to the circuit.
- Read the current in the display. In the 10A AC range, right auxiliary display frequency.
- Press and hold the “MODE” button to indicate “Hz”.
- Read the frequency in the display.
- Momentarily press the “MODE” button again to indicate “%”.
- Read the % duty cycle in the display.
- Press and hold the “MODE” button to return to current measurement.
- Press “EXIT” for 2 seconds into the function of AC+DC. Test DC and AC TURE Rms.

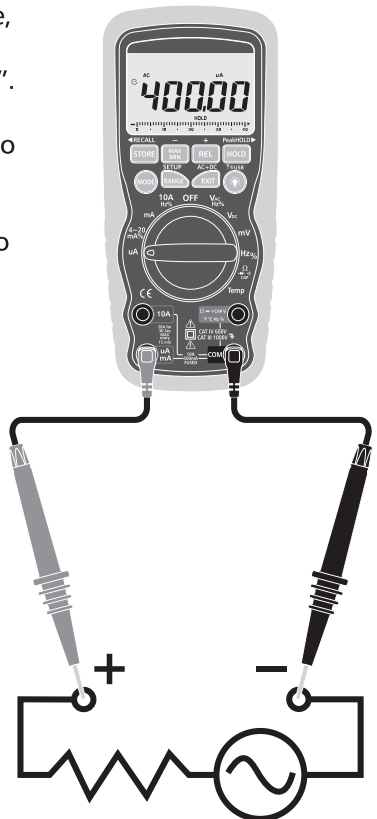

6-6. Resistance Measurements

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any resistance measurements. Remove the batteries and unplug the line cords.


- Set the function switch to the " Ω / \rightarrow / \rightarrow /CAP" position.
- Insert the black test lead banana plug into the "COM" jack. Insert the red test lead banana plug into the " Ω / \rightarrow / \rightarrow /CAP/V/ $^{\circ}$ F/ $^{\circ}$ C/Hz%" jack.
- Press the "MODE" button to indicate " Ω " on the display.
- Touch the test probe tips across the circuit or part under test. It is best to disconnect one side of the part under test so the rest of the circuit will not interfere with the resistance reading.
- Read the resistance in the display.

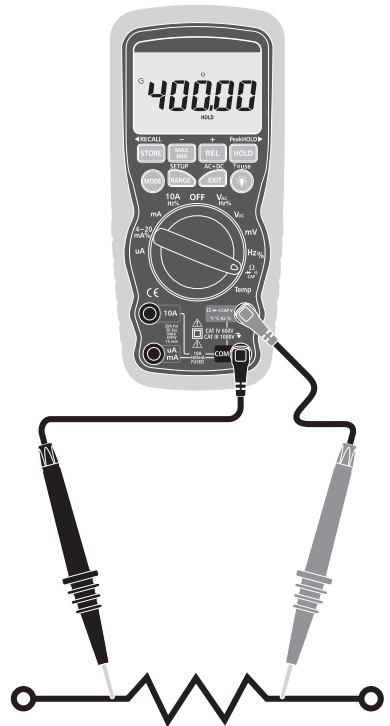

6-7. Continuity Check


WARNING: To avoid electric shock, never measure continuity on circuits or wires that have voltage on them.

- Set the function switch to the " Ω / \rightarrow / \rightarrow / \rightarrow "/CAP" position.
- Insert the black lead banana plug into the "COM" jack. Insert the red test lead banana plug into the " Ω / \rightarrow / \rightarrow / \rightarrow "/CAP/V $^{\circ}$ F/ $^{\circ}$ C/Hz%" jack.
- Press the "MODE" button to indicate " \rightarrow " and " Ω " on the display
- Touch the test probe tips to the circuit or wire you wish to check.
- If the resistance is less than approximately 35Ω , the audible signal will sound. If the circuit is open, the display will indicate "OL".

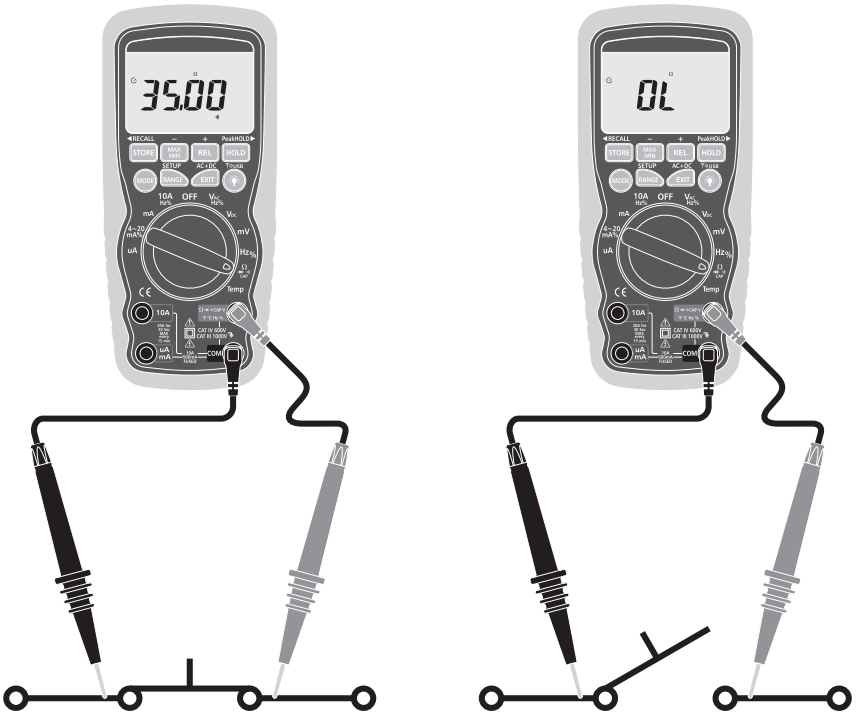

6-8. Diode Test


- Set the function switch to the “ $\Omega/\rightarrow/\rightarrow$ ” /CAP” position.
- Insert the black test lead banana plug into the “COM” jack. Insert the red test lead banana plug into the “ $\Omega/\rightarrow/\rightarrow$ /CAP/V^oF/°C/Hz%” jack.
- Press the “MODE” button to indicate “ \rightarrow ” and “V” on the display.
- Touch the test probes to the diode under test. Forward voltage will typically indicate 0.400 to 0.700V. Reverse voltage will indicate “OL”. Shorted devices will indicate near 0V and an open device will indicate “OL” in both polarities.

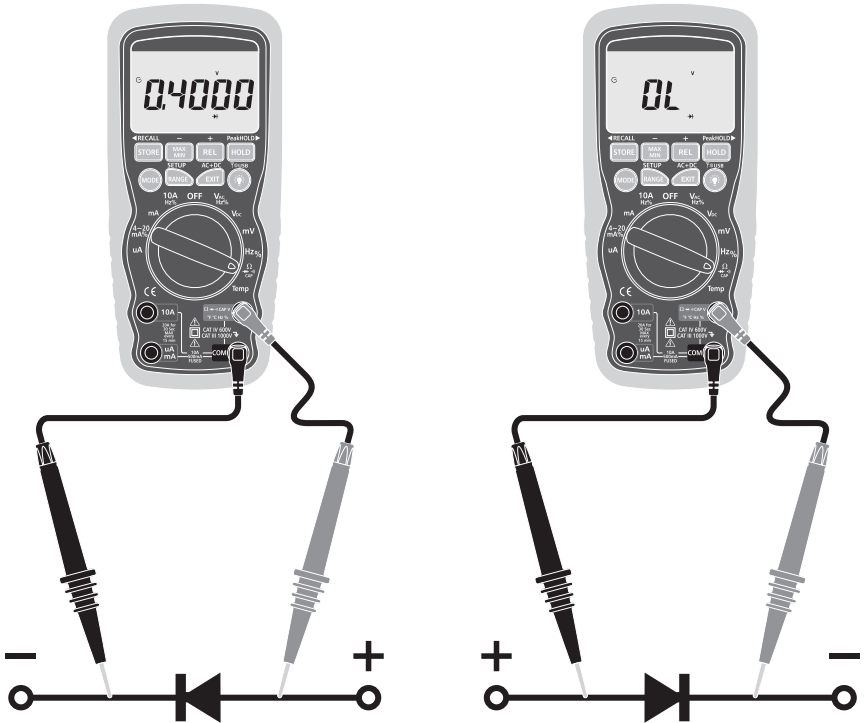

6-9. Capacitance Measurements

WARNING: To avoid electric shock, disconnect power to the unit under test and discharge all capacitors before taking any capacitance measurements. Remove the batteries and unplug the line cords.

- Set the function switch to the " $\Omega/\rightarrow/\rightarrow$ /CAP" position.
- Insert the black test lead banana plug into the "COM" jack.
- Insert the red test lead banana plug into the " $\Omega/\rightarrow/\rightarrow$ /CAP/V/°F/°C/Hz%" jack.
- Press the "MODE" button to indicate "F".
- Touch the test leads to the capacitor to be tested.
- Read the capacitance value in the display

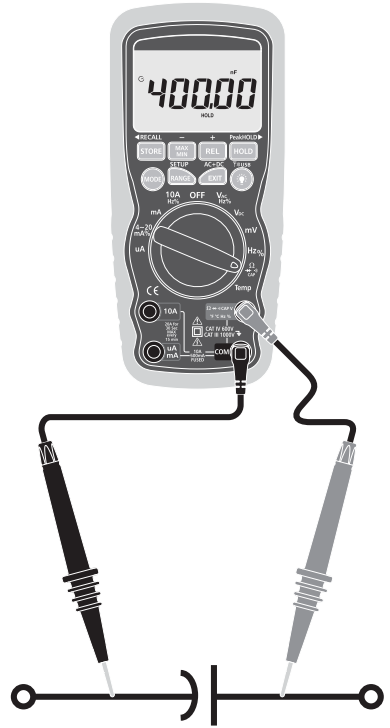

6-10. Temperature Measurements


- Set the function switch to the “Temp” position.
- Insert the Temperature Probe into the input jacks, making sure to observe the correct polarity.
- Press the “MODE” button to indicate “°C” or “°F”
- Touch the Temperature Probe head to the part whose temperature you wish to measure. Keep the probe touching the part under test until the reading stabilizes (about 30 seconds).
- Read the temperature in the display.

Note: The temperature probe is fitted with a type K mini connector. A mini connector to banana connector adaptor is supplied for connection to the input banana jacks.



6-11. Frequency (Duty Cycle) Measurements (Electronic)

- Set the function switch to the “Hz/%” position.
- Insert the black lead banana plug into the “COM” jack.
- Insert the red test lead banana plug into the “ $\Omega/\rightarrow/\text{}$ /CAP/N/°F/°C/Hz%” jack.
- Touch the test probe tips to the circuit under test.
- Read the frequency on the display.
- Press the “MODE” button to indicate “%”.
- Read the % duty cycle in the display.

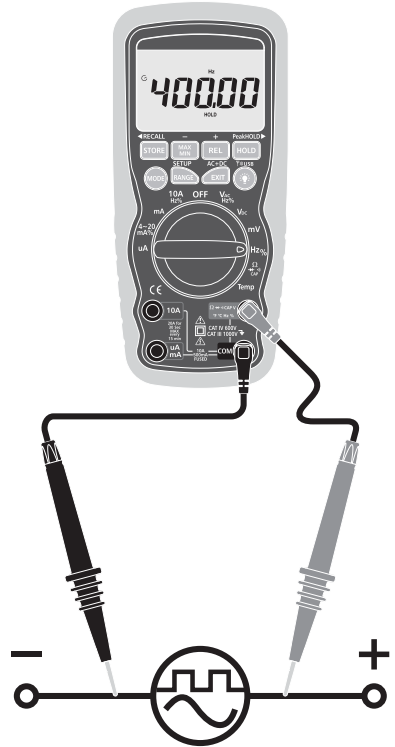

6-12. %4–20mA Measurements

- Set up and connect as described for DC mA measurements.
- Set the function switch to the “4-20mA%” position.
- The meter will display loop current as a % with 0mA=-25%, 4mA=0%, 20mA=100%, and 24mA=125%.

6-13. Autoranging/Manual Range Selection

When the meter is first turned on, it automatically goes into Autoranging. This automatically selects the best range for the measurements being made and is generally the best mode for most measurements. For measurement situations requiring that a range be manually selected, perform the following:

- Press the "RANGE" key. The "AUTO" display indicator will turn off.
- Press the "RANGE" key to step through the available ranges until you select the range you want.
- To exit the Manual Ranging mode and return to Autoranging, press EXIT

Note: Manual ranging does not apply for the Temperature functions.

6-14. MAX/MIN

- Press the "MAX/MIN" key to activate the MAX/MIN recording mode. The display icon "MAX" will appear. The meter left auxiliary display will display and hold the maximum reading and will update only when a new "max" occurs. The display icon "MIN" will appear. The right auxiliary display meter will display and hold the minimum reading and will update only when a new "min" occurs.
- To exit MAX/MIN mode press "EXIT"

6-15. Relative Mode

The relative measurement feature allows you to make measurements relative to a stored reference value. A reference voltage, current, etc. can be stored and measurements made in comparison to that value. The displayed value is the difference between the reference value and the measured value.

Note: Relative mode does not operate in the 4-20mA function.

- Perform the measurement as described in the operating instructions.
- Press the "REL" button to store the reading in the display and the "REL" indicator will appear on the display.
- Left auxiliary display display the margin of initial value and the current value. Right auxiliary display display the initial reading. Main display the reading after REL TEST.
- Press the "EXIT" button to exit the relative mode.

6-16. Display Backlight

Press the "☾" button to turn the backlight on. The backlight will automatically turn off after SET time. Press the "EXIT" button to exit the backlight on mode.

6-17. HOLD

The hold function freezes the reading in the display. Press the "HOLD" key momentarily to activate or to exit the HOLD function.

6-18. PEAK HOLD

The Peak Hold function captures the peak AC or DC voltage or current. The meter can capture negative or positive peaks as fast as 1 millisecond in duration. Momentarily press the "PEAK" button, "PEAK" and "MAX" will display in left auxiliary display. "MIN" will display in right auxiliary display. The meter will update the display each time a lower negative peak occurs. Press the "EXIT" button to exit the PEAK HOLD mode. Auto Power Off feature will be disabled automatically in this mode.

6-19. Data Record (Store/Recall)

• STORE function

In the current testing mode, press "STORE" button one time, enter into STORE function.

On the left upper corner of LCD shows NO XXXX, which states current storage serial number. Then press "PeakHOLD" button to change into the initial serial number 0000. (Press again it will change back).

On the right upper corner of LCD shows XXXX, which states how many current storage is used.

Press "STORE" button again, enter into recording interval time set up function.

On the left upper shows 0000 S, which states recording interval time; using button "+" & "-" to select, the range is 0~255 seconds.

When the recording interval time is 0000 S, then press "STORE" button again to change into manual recording. Press the STORE button again to record once.

When the recording interval time is 1~255 S, then press "STORE" button again to start recording automatically from 0000.

Recording times is showed on the left upper corner, data is showed on the right upper corner (Due to digitally limitation, there is only display preceding four numbers)

To finish above STORE function, press "EXIT" button shortly.

If you expect to clear all memory data:

While power on, hold "EXIT" button, and switch from OFF to random and then release "EXIT" button, the LCD will flash thrice and buzzer thrice too, which means all memory data is cleared.

• **RECALL function**

Press “**STORE**” button two seconds to enter into RECALL function.

On the left upper corner shows XXXX , which states current storage serial number. On the right upper corner shows XXXX, which states how many current storage is used.

Press “**PeakHOLD**” button shortly once to scan data from 0000 to XXXX continuously. Press again then scan again.

Use button “+” & “-” to select serial number XXXX on the left upper corner and record data on the right upper corner.

To finish above RECALL function, press “**EXIT**” button.

6-20.Wireless Data Sending Function

According to wireless receiver user’s guide attached, set up the USB software and wireless receiver on the PC, and then open up the operating interface. When ready, hold “**Υ»USB**” button for 2 secs, Entering into wireless sending state, The RF icon will flash on the upper right of LCD.

When wireless receiver receives the signal, it will flash and meanwhile wireless receiver indicate light willflash synchroly. Setting up COM input of PC, press link button to ON, on operating interface will show tested parameter data synchroly and record in the PC.

Due to the electricity used increased(about 28mA, much more than 5mA), so it is designed to record first and concentrate to send quickly working mode, such as record per second. It takes two and half hours to finish testing and records 9000 data. Press “**EXIT**” to exit recording state and then hold “**STORE**” button for 2 seconds to enter into RECALL state, and press “**HOLD**” button, so that 9000 data stored is sent to PC in wave. On the PC operating interface, it is needed to set up start time and interval between each recording.

PC operation manual, please refer to wireless receiver user’s guide.

The distance is about 10M.

6-21.Parameter Setting Up(SET)

- Press the "RANGE" button second seconds to enter into SET function. Then press shortly once, change on setting content.

Setting content includes(in sequence):

- A: Upper limit buzzer alarm
- B: Lower limit buzzer alarm
- C: Auto power off time
- D: Turn off phonating
- E: Backlit time

Use "◀", "+", "- ", "▶" buttons to select the parameter.

- Press "SETUP" button continuously to switch to setting content, till exiting set up to testing mode. So the updated setting content is saved. If press "EXIT" button in this period, all setting can't be saved.

6-22.AC+DC

In all the measuring mode VAC,mV(AC),10A(AC),mA(AC),uA(AC), press "EXIT" button for 2seconds to enters into AC+DC testing. The precision is the same as AC measure. LCD shows AC+DC signal. Press "EXIT" button to exit.

6-23.Low Battery Indication

When the "🔋" icon appears alone in the display, the battery should be replaced.

7.Maintenance

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the back cover or the battery or fuse covers.

WARNING: To avoid electric shock, do not operate your meter until the battery and fuse covers are in place and fastened securely.

This MultiMeter is designed to provide years of dependable service, if the following care instructions are performed:

- **Keep The Meter Dry.** If it gets wet, wipe it off.
- **Use And Store The Meter In Normal Temperatures.** Temperature extremes can shorten the life of the electronic parts and distort or melt plastic parts.
- **Handle The Meter Gently And Carefully.** Dropping it can damage the electronic parts or the case.
- **Keep The Meter Clean.** Wipe the case occasionally with a damp cloth. DO NOT use chemicals, cleaning solvents, or detergents.
- **Use Only Fresh Batteries Of The Recommended Size And Type.** Remove old or weak batteries so they do not leak and damage the unit.
- **If The Meter Is To Be Stored For A Long Period Of Time.** The batteries should be removed to prevent damage to the unit.

7-1.Battery Installation

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the battery cover.

- Turn power off and disconnect the test leads from the meter.
- Open the rear battery cover by removing two screws (B) using a Phillips head screwdriver.
- Insert the battery into battery holder, observing the correct polarity.
- Put the battery cover back in place. Secure with the screws.

WARNING: To avoid electric shock, do not operate the meter until the battery cover is in place and fastened securely.


NOTE: If your meter does not work properly, check the fuses and batteries to make sure that they are still good and that they are properly inserted.

7-2.Replacing The Fuses

WARNING: To avoid electric shock, disconnect the test leads from any source of voltage before removing the meter cover.

- Disconnect the test leads from the meter.
- Remove the protective rubber holster.
- Remove the battery cover (Two "B" screws) and the battery.
- Remove the six "A" screws securing the rear cover.
- Gently remove the old fuse and install the new fuse into the holder.
- Always use a fuse of the proper size and value (0.5A/1000V fast blow for the 400mA range [SIBA 70-172-40], 10A/1000V fast blow for the 20A range [SIBA 50-199-06]).
- Replace and secure the rear cover, battery and battery cover.

WARNING: To avoid electric shock, do not operate your meter until the fuse cover is in place and fastened securely.

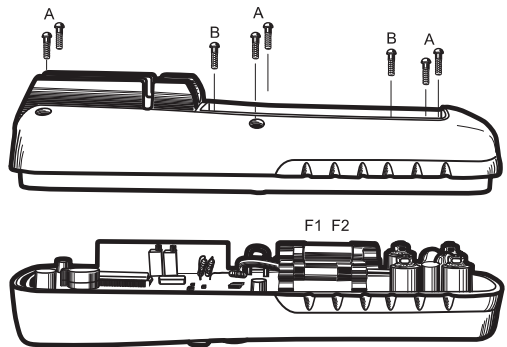

8. Specifications

Function	Range	Resolution	Accuracy
DC Voltage	400mV	0.01mV	$\pm(0.06\% \text{ reading} + 4 \text{ digits})$
	4V	0.0001V	
	40V	0.001V	
	400V	0.01V	
	1000V	0.1V	
AC Voltage (AC+DC) 50 to 1000Hz	400mV	0.01mV	$\pm(1.0\% \text{ reading} + 40 \text{ digits})$
	4V	0.0001V	$\pm(1.0\% \text{ reading} + 30 \text{ digits})$
	40V	0.001V	
	400V	0.01V	
	1000V	0.1V	
All AC voltage ranges are specified from 5% of range to 100% of range			
DC Current	400 μ A	0.01 μ A	$\pm(1.0\% \text{ reading} + 3 \text{ digits})$
	4000 μ A	0.1 μ A	
	40mA	0.001mA	
	400mA	0.01mA	
	10A	0.001A	
	(20A:30 sec max with reduced accuracy)		
AC Current (AC+DC) 50 to 1000Hz	400 μ A	0.01 μ A	$\pm(1.0\% \text{ reading} + 3 \text{ digits})$
	4000 μ A	0.1 μ A	
	40mA	0.001mA	
	400mA	0.01mA	
	10A	0.001A	
	(20A: 30 sec max with reduced accuracy)		
All AC voltage ranges are specified from 5% of range to 100% of range			

NOTE: Accuracy is stated at 18°C to 28°C (65°F to 83°F) and less than 75%RH.


AC switch according to the calibration of sine wave. It generally increase $\pm(2\% \text{ reading} + 2\% \text{ full scale})$ if non sine wave in the wave crest less than 3.0.

Function	Range	Resolution	Accuracy
Resistance	400 Ω	0.01 Ω	$\pm(0.3\%$ reading + 9 digits)
	4k Ω	0.0001k Ω	$\pm(0.3\%$ reading + 4 digits)
	40k Ω	0.001k Ω	
	400k Ω	0.01k Ω	$\pm(2.0\%$ reading + 10 digits)
	4M Ω	0.001M Ω	
	40M Ω	0.001M Ω	
Capacitance	40nF	0.001nF	
	400nF	0.01nF	$\pm(3.5\%$ reading + 10 digits)
	4 μ F	0.0001 μ F	
	40 μ F	0.001 μ F	
	400 μ F	0.01 μ F	$\pm(5\%$ reading + 10 digits)
	4000 μ F	0.1 μ F	
	40mF	0.001mF	
Frequency (electronic)	40Hz	0.001Hz	$\pm(0.1\%$ reading + 1 digits)
	400Hz	0.01Hz	
	4kHz	0.0001kHz	
	40kHz	0.001kHz	
	400kHz	0.01kHz	
	4MHz	0.0001MHz	
	40MHz	0.001MHz	
	100MHz	0.01MHz	Not specified
	Sensitivity: 0.8V rms min. @ 20% to 80% duty cycle and <100kHz; 5Vrms min @ 20% to 80% duty cycle and > 100kHz.		
Frequency (electrical)	40.00HZ-10kHz	0.01Hz-0.001kHz	$\pm(0.5\%$ reading)
	Sensitivity:1Vrms		
Duty Cycle	0.1 to 99.90%	0.01%	$\pm(1.2\%$ reading + 2 digits)
	Pulse width: 100 μ s - 100ms, Frequency: 5Hz to 150kHz		
Temperature (type-K)	-50 to 1200 $^{\circ}$ C	0.1 $^{\circ}$ C	$\pm(1.0\%$ reading + 2.5 $^{\circ}$ C)
	-58 to 2192 $^{\circ}$ F	0.1 $^{\circ}$ F	$\pm(1.0\%$ reading + 4.5 $^{\circ}$ F)
	(probe accuracy not included)		
4-20mA%	-25 to 125%	0.01%	± 50 digits
	0mA=-25%, 4mA=0%, 20mA=100%, 24mA=125%		

Note: Accuracy specifications consist of two elements:

- (% reading) – This is the accuracy of the measurement circuit.
- (+ digits) – This is the accuracy of the analog to digital converter.

9. General Specifications

Store capacitance:	9999
Enclosure:	Double molded, waterproof
Shock (Drop Test):	2M
Diode Test:	Test current of 0.9mA maximum, open circuit voltage.2.8V DC typical.
Continuity Check:	Audible signal will sound if the resistance is less than.35Ω (approx.), test current <0.35mA.
PEAK:	Captures peaks >1ms.
Temperature Sensor:	Requires type K thermocouple.
Input Impedance:	>10MΩ VDC & >9MΩ VAC
AC Response:	True rms
AC True RMS:	The term stands for “Root-Mean-Square” which represents the method of calculation of the voltage or current value. Average responding multimeters are calibrated to read correctly only on sine waves and they will read inaccurately on non-sine wave or distorted signals. True rms meters read accurately on either type of signal.
ACV Bandwidth:	50Hz to 1000Hz
Crest Factor:	≤3 at full scale up to 500V, decreasing linearly to ≤1.5 at 1000V.
Display:	40,000 count backlit liquid crystal with bargraph.
Overrange indication:	“OL” is displayed
Auto Power Off:	15 minutes (approximately) with disable feature
Polarity:	Automatic (no indication for positive); Minus (-) sign for negative
Measurement Rate:	2 times per second, nominal
Low Battery Indication:	“  ” is displayed if battery voltage drops below operating voltage.
Battery:	One 9V (NEDA 1604) battery.
Fuses:	mA, μA ranges; 0.5A/1000V ceramic fast blow A range; 10A/1000V ceramic fast blow
Operating Temperature:	5°C to 40°C (41°F to 104°F)
Storage Temperature:	-20°C to 60°C (-4°F to 140°F)
Operating Humidity:	Max 80% up to 31°C (87°F) decreasing linearly to 50% at 40°C (104°F)
Storage Humidity:	<80%
Operating Altitude:	2000M maximum.
Weight:	342g (includes holster).
Size:	187 x 81 x 50mm (includes holster)
Safety:	This meter is intended for origin of installation use and protected, against the users, by double insulation per EN61010-1 and IEC61010-1 2nd Edition (2001) to Category IV 600V and Category III 1000V; Pollution Degree 2. The meter also meets UL 61010-1, 2nd Edition (2004), CAN/CSA C22.2 No. 61010-1 2nd Edition (2004), and UL 61010B-2-031, 1st Edition (2003)